

Model
**1998
ACCORD
4-DOOR**

Applicable To
ALL

File Under



Bulletin No.

98-060

Issue Date

SEPTEMBER 1998

Rear Seat-back Lock Is Hard to Turn

SYMPTOM

The rear seat-back lock is hard to turn.

PROBABLE CAUSE

Not enough lubricant on the rear seat-back latch.

CORRECTIVE ACTION

Remove the rear seat-back latch, lubricate it, and reinstall it.

REQUIRED MATERIALS

White Lithium Grease (aerosol): P/N 08732-0005
(Each can of grease will repair about 25 vehicles.)

WARRANTY CLAIM INFORMATION


The normal warranty applies.

Failed Part P/N 82220-S84-A01

REPAIR PROCEDURE

1. Remove the latch assembly from the rear seat-back as described in the Body section of the 1998 Accord Shop Manual.

2. Lubricate the latch assembly:

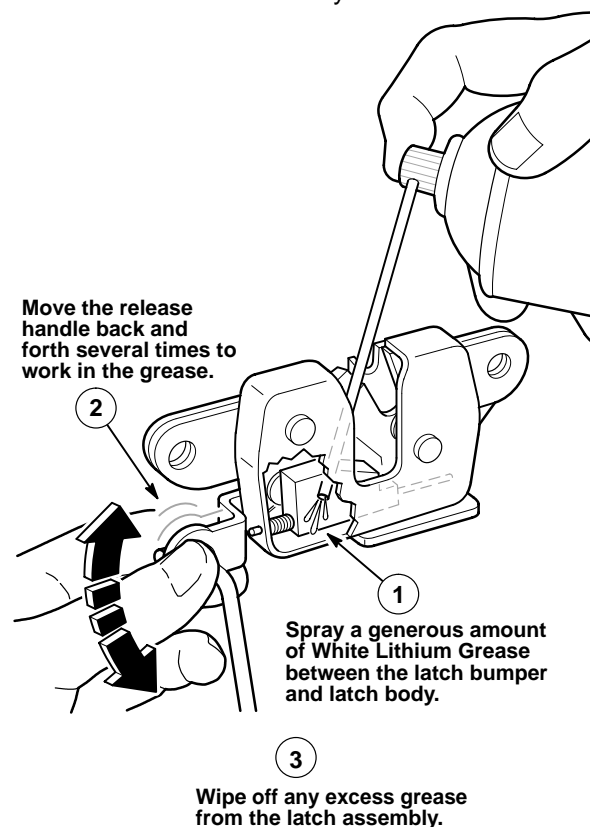

3. Reinstall the latch assembly in the vehicle.
4. Make sure that the seat-back lock turns smoothly and the seat-back latch operates properly.